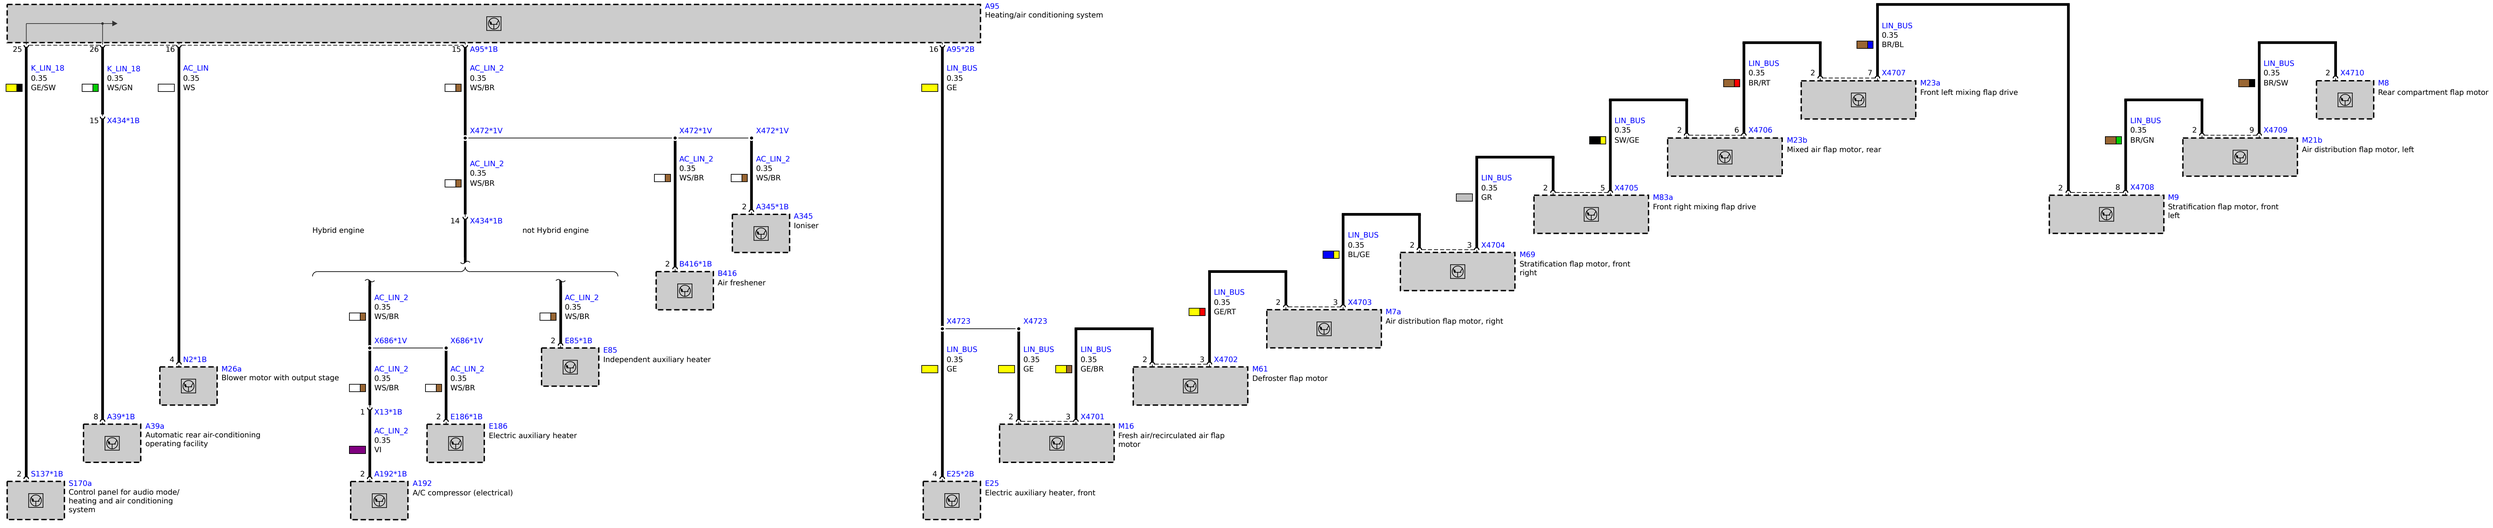
A95
Heating/air conditioning system
25
K_LIN_18
0.35
GE/SW
26
K_LIN_18
0.35
WS/GN
15
X434*1B
16
AC_LIN
0.35
WS
15
A95*1B
AC_LIN_2
0.35
WS/BR
X472*1V
AC_LIN_2
0.35
WS/BR
14
X434*1B
Hybrid engine
not Hybrid engine
X472*1V
AC_LIN_2
0.35
WS/BR
2
B416*1B
B416
Air freshener
X472*1V
AC_LIN_2
0.35
WS/BR
2
A345*1B
A345
Ioniser
AC_LIN_2
0.35
WS/BR
X686*1V
AC_LIN_2
0.35
WS/BR
1
X13*1B
AC_LIN_2
0.35
VI
X686*1V
AC_LIN_2
0.35
WS/BR
2
E186*1B
E186
Electric auxiliary heater
AC_LIN_2
0.35
WS/BR
2
E85*1B
E85
Independent auxiliary heater
4
N2*1B
M26a
Blower motor with output stage
8
A39*1B
A39a
Automatic rear air-conditioning operating facility
2
S137*1B
S170a
Control panel for audio mode/ heating and air conditioning system
2
A192*1B
A192
A/C compressor (electrical)
16
A95*2B
LIN_BUS
0.35
GE
X4723
LIN_BUS
0.35
GE
X4723
LIN_BUS
0.35
GE
LIN_BUS
0.35
GE/BR
2
3
X4701
M16
Fresh air/recirculated air flap motor
2
3
X4702
M61
Defroster flap motor
LIN_BUS
0.35
GE/RT
2
3
X4703
M7a
Air distribution flap motor, right
LIN_BUS
0.35
BL/GE
2
3
X4704
M69
Stratification flap motor, front right
LIN_BUS
0.35
GR
2
5
X4705
M83a
Front right mixing flap drive
LIN_BUS
0.35
SW/GE
2
6
X4706
M23b
Mixed air flap motor, rear
LIN_BUS
0.35
BR/RT
2
7
X4707
M23a
Front left mixing flap drive
LIN_BUS
0.35
BR/BL
2
8
X4708
M9
Stratification flap motor, front left
LIN_BUS
0.35
BR/GN
2
9
X4709
M21b
Air distribution flap motor, left
LIN_BUS
0.35
BR/SW
2
X4710
M8
Rear compartment flap motor
4
E25*2B
E25
Electric auxiliary heater, front